

Department Reports
9.25.2025

ELECTRIC DISTRIBUTION

Tickets, locates
Replaced 45' C1 pole in west rural.
Non Pay turn offs
Set up tables and chairs at Airport.
Reported outage at 920 N. Anthony. Blown fuse.
Maintenance in west rural.
Reported outage at anhydrous plant. Blown fuse.
Replaced lights on light list.
Turn On/Off orders

POWER PLANT

Rounds

STREET

Grading town, lake
Mowing town
Mowing airport
Sweeping airport
Prep for fly in and helped day of fly in
Clean up after fly in
Picked up tree limbs

WATER/WASTEWATER

Rounds, tickets, locates
S. Springfield leak repair
Packing on pump 2 high service
Lift station repairs
Sunrise 2nd water service locates

MECHANIC

#49 A 2014 FORD EXPLORER CHECKED ON COURTESY CAR TO INSURE IT STARTS & HAS FUEL, DROVE IT SHORT A DISTANCE. CLEANED INTERIOR AND WASHED OUTSIDE OF CAR. SPOT PAINTED FRONT BUMPER WHERE PAINT WAS COMING OFF BUMPER COVER.

#80 W 2006 F150 COMBINATION TURN SIGNAL/HEADLIGHT DIMMER SWITCH BAD. ORDERED SWITCH FROM NAPA. REMOVE AND REPLACE SWITCH IN STEERING COLUMN. LIGHTS WORK CORRECTLY NOW. WASHED OUTSIDE OF TRUCK.

#11 PWE METER READER TRUCK. TIRES WORN UNDER 2 32NDS. NEED TIRES. REPLACED BAD WORN PARTS ON FRONT END LAST MONTH SO ITS READY FOR TIRES AND ALIGNMENT. WENT TO OUR LOCAL TIRE DEALERS & HAD QUOTES

PRINTED OUT TO COMPARE FOR BEST PRICES, TURNED IN PURCHASE ORDER THAT WAS APPROVED. ORDERED TIRES.

#40 S 2025 PELICAN SWEEPER AUTO GREASE LINE CRACKED/POPPED AGAIN. WORKED WITH THE SWEEPER WARRANTY MECHANIC TO FIX THIS ISSUE. WE DISCOVERED FROM THE FACTORY THE CHECK VALVE FOR THIS LINE WAS INSTALLED BACKWARDS NOT LETTING GREASE PUMP THROW LINE PAST CHECK VALVE TO BEARING TO DO ITS JOB AND WAS STUCK JUST PRESSURING UP PLASTIC LINE TILL IT FOUND A WEAK SPOT TO POP. FLIPPED VALVE & NOW GREASE CAN MOVE TO THE BEARING. PROBLEM SHOULD BE FIXED NOW.

#17 PK 2022 GRASSHOPPER NO START ISSUE. FOUND NO SPARK AT PLUG WIRES. MOST LIKELY CRANK SENSOR IS THE ISSUE AS THAT IS WHERE COMPUTER READS DATA TO SEND POWER TO COIL PACKS. IF CRANK SENSOR DOES NOT FIX IT ECU CONTROL MODULE WILL BE BAD. WITH THESE NEWER FUEL INJECTED MOWER ENGINES WHEN REPLACING A ECU, A 19636 DIAGNOSTIC TOOL KIT IS NEEDED TO FLASH THE NEW COMPUTER TO SPECIFIC VIN ENGINE CODE SO NEW PART WILL WORK. ORDERED NEEDED PARTS AND DIAGNOSTIC TOOL TO COMPLETE JOB.

HELPED OUT AT AIRPORT FOR AIR TOUR DAY. WAS A VERY GOOD DAY FOR IT AND A GREAT TURN OUT. HIGH FIVE TO EVERYONE THAT HELPED PLAN EVENT, HELPED GET GROUNDS READY & HELPED WITH THE EVENT TO MAKE IT AS GOOD AS IT COULD BE.

#22 W 2015 F350 BATTERY KEEPS DEPLETING IN THE WEAK ZONE STARTING SLOW. BATTERY TESTED BAD. REMOVED AND REPLACED BATTERY.

#35 L 1990 JOHN DEERE 970 TRACTOR SERVICE: CHANGE OIL & FILTER, FUEL FILTERS, AIR FILTER. CHECKED FLUID LEVELS & TIRES. NEEDS TIRE REPAIR ON REAR TIRE AS IT LEAKS DOWN OVER NIGHT.

#50 FD 1998 AERIAL AIR LINE LEAK: FOUND ON PASS FRONT ABOVE TIRE AREA THE AIR SUPPLY LINE HAS BLOWN. GOING TO TRY A COMPRESSION FITTING TO SEE IF IT WILL FIX IT, IF NOT A NEW LINE HAS TO BE RAN FRONT TO BACK

WRITE UP REPAIR WORK ORDERS, FILE WORK/SERVICE REPAIR ORDERS, PICK UP TOOLS AND SWEEP SHOP.