

1825 South Webster Avenue, Suite 202 Green Bay, WI 54301 Phone: 920-432-1232 Website <u>www.aglgb.com</u> agl@aglgb.com

August 8, 2024

Fairview Manor Needs Assessment

Replace roofing, tear off and install new insulation and EPDM Existing EPDM membrane roof installed in 2004 at end of life, seams are	\$529,920.00
separating. Replace roofing and insulation. Replace metal roof edging	\$20,580.00
Metal cap and roof edging circa 1968 to be replaced along with roofing	φ20,560.00
Relocate roof access ladder and roof hatch	\$7,500.00
Roof access ladder does not have sufficient clearance to wall for foot placement.	Ψ1,000.00
Cannot move ladder out from wall as it would impede stair access. Ladder and roof	
access hatch to be relocated.	
Replace cracked concrete cap by incinerator stack, tuck point brick, replace	\$25,000.00
brick, install clear sealer	
Concrete cap on former elevator shaft above roof is original and severely cracked.	
Brick face on shaft walls with spalled surfaces to be replaced.	
Replace 11 exit signs with LED	\$2,750.00
Exit signs replace to LED for energy efficiency	
Replace hall carpeting	\$23,540.00
Hallway carpeting installed in 2002 is beyond useful life. Replace.	
Replace 3-fan coil units in corridor ceiling	\$33,240.00
Fan coil units are original from 1968 and beyond useful life	
Replace can lights in corridor	\$14,400.00
Replace corridor can lights with LED can lights for energy efficiency.	
Replace apartment entry doors/frames/hardware	\$130,000.00
Wood entry doors/frames are original from 1968 and showing wear, splits,	
delamination. Replace with new.	
Add handrail to corridors	\$17,610.00
Install handrail in corridor for tenant safety	
Change out stairwell doors/frames/hardware	\$31,500.00
Stairwell wood doors and hollow metal frames are original from 1968 and are	
showing wear, splits, delamination. Do not close properly, to be replaced for safety	
Replace stairwell handrails	\$13,000.00
Stair wood handrails are original from 1968. Present configuration does not meet	
code. Replace for tenant safety.	#40.000.00
Replace stair treads	\$12,000.00
Existing vinyl stair treads nosing cracking. Replace for tenant safety.	¢40.070.00
Replace stair landings with rubber tile	\$10,370.00
Stair landings are carpet from 2002. Carpet beyond useful life. Replace with rubber lile for tenant safety.	
ie ior terrarit salety.	

Laundry rooms, replace drain piping. Replace dryer venting to sidewall Replace drain piping and dryer vent duct and reconfigure room to clean up	\$42,565.00
appearance.	#75 400 00
Replace exterior hollow metal doors/frames with aluminum doors/frames in community room, second floor patio, front entry, side exits Existing exterior hollow metal doors/frames are original from 1968 and are rusting badly. Replace with aluminum.	\$75,120.00
Replace community kitchen flooring, cabinets, range hood, roll-up doors, lower serving counter, lighting Community room kitchen is original from 1968, is showing signs of wear and is not ADA accessible.	\$20,000.00
Community room, replace windows, lighting, closet doors, flooring, paint walls/ceiling Carpet was replaced in 2002 and is at end of life. Lighting to upgrade to LED for energy efficiency.	\$51,410.00
Replace community room split systems Air conditioning split system installed 35 years ago is past end of life.	\$31,450.00
nstall new mailboxes, larger horizontal box style and new wall framing Present mailboxes do not meet USPS mailbox requirements.	\$20,000.00
New Hi-Lo drinking fountains Provide Hi-Lo drinking fountains to meet ADA requirements	\$5,500.00
Convert hair dressing room to storage Former hair dressing room has not been used for years. Convert this room into usable storage space	\$3,000.00
Separate storm line and sewer line Storm line and sewer line are combined withing the building. Separate lines to neet city requirements.	\$87,575.00
Replace sewer line in crawl space ife expectancy for cast iron pipe is 50 years. Existing sewer line is original from 968 – 56 years ago.	\$125,590.00
Relocate boilers from basement to new grade level mechanical/electrical boom at end of building ife expectancy for high efficiency boilers is 15 years. Present boilers are 12 years lid and exhibit problems and need more maintenance now. Replace with new flove boilers out of basement which is subject to flooding.	\$877,000.00
reate new Grade level mechanical Room – Assume 800 s.f. resent basement mechanical room subject to flooding. Relocate to grade	\$240,000.00
Replace fin pipe radiation covers and fin pipe, zone valves, ball valves, inions, balancing valves, coin vents all apartments and public areas fin pipe and covers were replaced 2004. Covers are dented, bent. Valves and enting at that time were not replaced. Replaced with new for appearance and to inimize maintenance on heating system.	\$428,850.00
Replace windows Vindows were replaced in 2000. Window replacement parts not available	\$264,000.00
deplace stucco panels with EIFS around windows With planter boxes removed. Remove remainder of stucco and replace with EIFS or uniform appearance and energy efficiency.	\$192,500.00
aint apartments to provide attractive appearance	\$158,150.00
eplace first floor drywall ceiling for heating piping replacement	\$14,175.00
Ipgrade heating line sizes due to boiler relocation	

46,620.00
46,620.00
3,500.00
9,000.00
9,000.00
\$1,500.00
.5,000.00
45,000.00
13,040.00
25,000.00
50,000.00
10,000.00
108,750.00
33,000.00
222 000 00
39,840.00
91,320.00
503,950.00
070,030.00
578,695.00
85,700.00
\$70,600.00