


Location


NE Alsbury Blvd & Heberle Dr

Signal Map

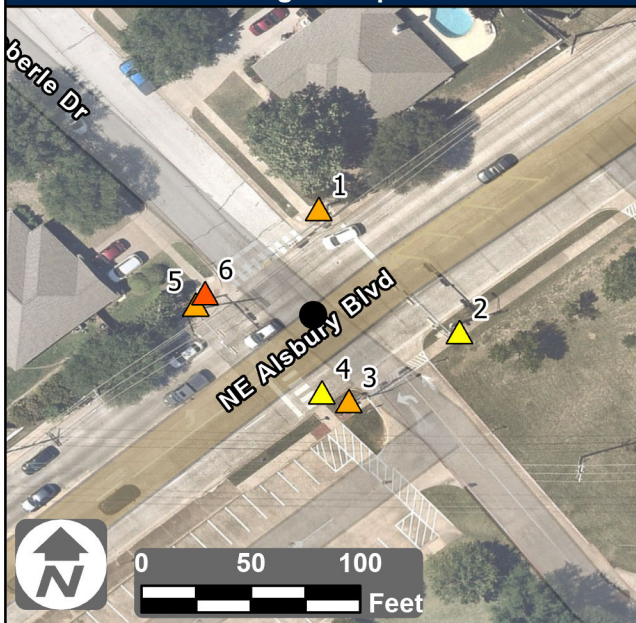

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	1	\$ 260
3	3	\$ 5,400
4	2	\$ 6,400
5	0	\$ 0
Total	6	\$ 12,060

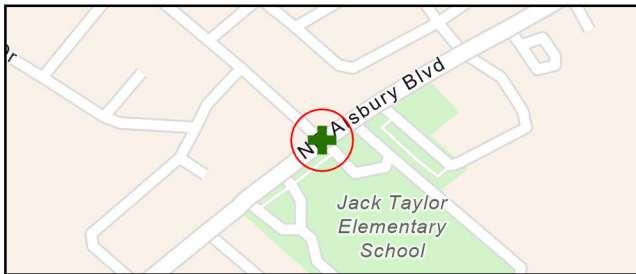

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol			X			X			Install countdown pedestrian signal head
Head does not show countdown		X		X					Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X			X					Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X	X	X	X				Remove PBs and replace with APS push buttons
Push button height is greater than 48"	X		X		X	X			Relocate pedestrian push buttons
Push button is missing band	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X	X	X	X	X			Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%	X		X		X	X			Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable				X					Remove and replace clear floor space
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X			Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	3	4	3	4	3	2			

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


NE McAlister Rd & NW Renfro St

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	2	\$ 520
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 520

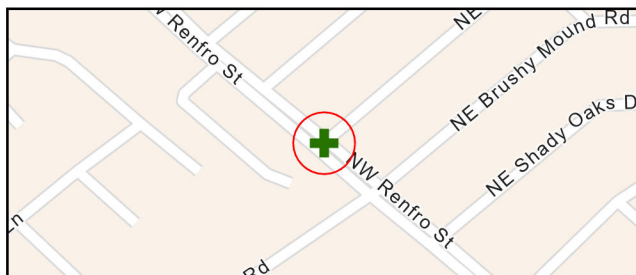

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%									
Cross slope at push button is greater than 2.1%	X	X							Remove and replace clear floor space
Floor at push button is not firm or stable		X							Remove and replace clear floor space
Push button is offset more than 5' from curb ramp run	X	X							Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	2	2							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location

NW Renfro St & NE/SW Alsbury Blvd

Signal Map

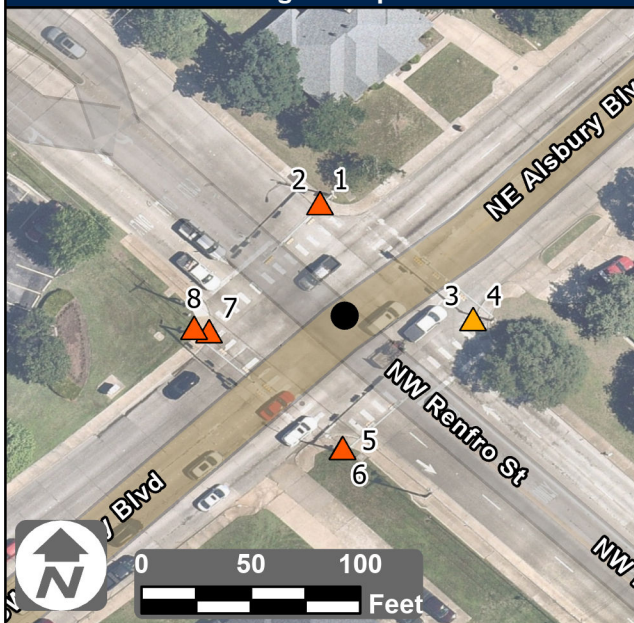

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	6	\$ 1,560
3	2	\$ 3,600
4	0	\$ 0
5	0	\$ 0
Total	8	\$ 5,160



Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown			X		X				Install countdown pedestrian signal head
Missing push button									
Missing adjacent button									
Distance to adjacent button is greater than 10 ft									
Missing speech message	X		X	X	X	X	X		Remove PBs and replace with APS push buttons
Push button height is greater than 48"					X	X	X		Relocate pedestrian push buttons
Push button is missing band	X	X	X	X		X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%	X	X	X	X	X			X	Remove and replace clear floor space
Cross slope at push button is greater than 2.1%							X	X	Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X		Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk			X	X					Relocate pedestrian push buttons
Push button does not service ramp									
Signal Priority	2	2	3	3	2	2	2	2	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


SW Alsbury Blvd & NW Summercrest Blvd

Signal Map

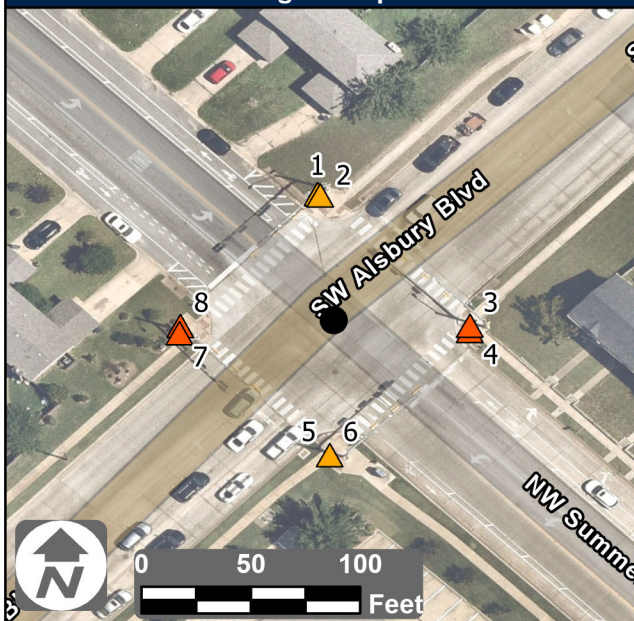

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	0	\$ 0
2 ▲	4	\$ 1,040
3 ▲	4	\$ 7,200
4 ▲	0	\$ 0
5 ▲	0	\$ 0
Total	8	\$ 8,240

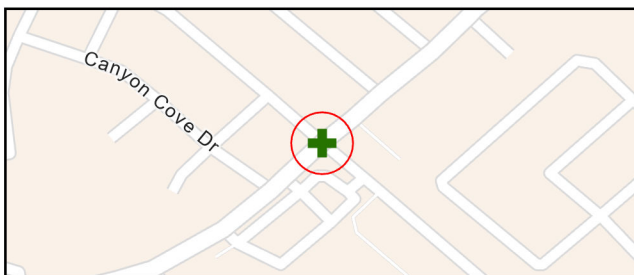

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button							X		Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X		X		X	X	X	Remove PBs and replace with APS push buttons
Push button height is greater than 48"	X				X	X			Relocate pedestrian push buttons
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X		X		X	X	X	Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X		X		X	X	X	Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X		X		X	X	X	Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X		X		X	X	X	Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%									
Cross slope at push button is greater than 2.1%			X	X				X	Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X	X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	3	3	2	2	3	3	2	2	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


W Renfro St & S Wilson St

Signal Map

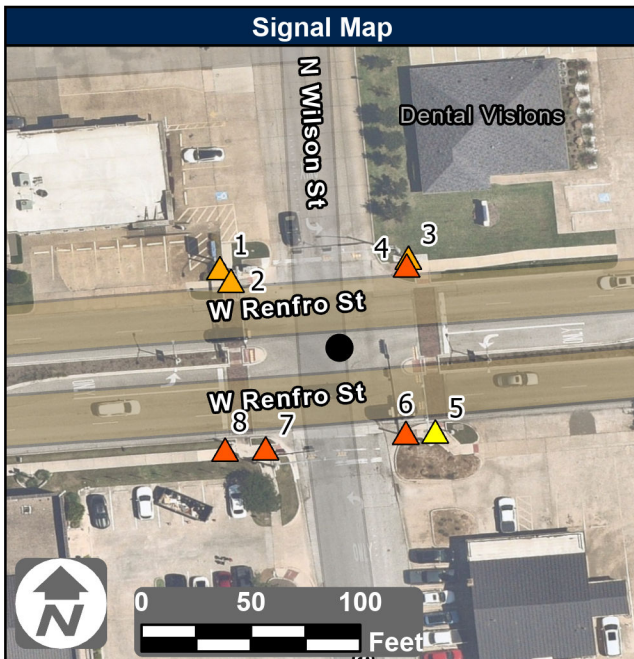

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	0	\$ 0
2 ▲	4	\$ 1,040
3 ▲	3	\$ 5,400
4 ▲	1	\$ 3,200
5 ▲	0	\$ 0
Total	8	\$ 9,640

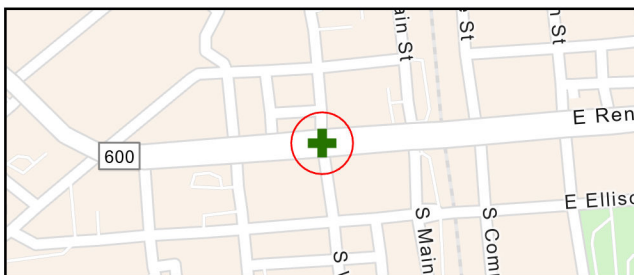

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown	X	X	X	X	X	X	X	X	Install countdown pedestrian signal head
Missing push button									
Missing adjacent button									
Distance to adjacent button is greater than 10 ft						X	X	X	Relocate pedestrian push buttons
Missing speech message	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%	X			X	X				Remove and replace clear floor space
Cross slope at push button is greater than 2.1%						X	X		Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X		X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	3	3	3	2	4	2	2	2	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


N Main St & W Renfro St

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	2	\$ 6,400
2	0	\$ 0
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 6,400

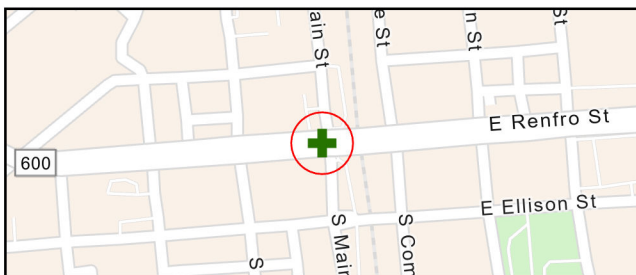

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head	X	X							Install countdown pedestrian signal head
Missing head symbol	X	X							Install countdown pedestrian signal head
Head does not show countdown	X	X							Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%									
Cross slope at push button is greater than 2.1%		X							Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X							Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	1	1							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


N Midblock of NW Summercrest Blvd

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	2	\$ 6,400
2	0	\$ 0
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 6,400

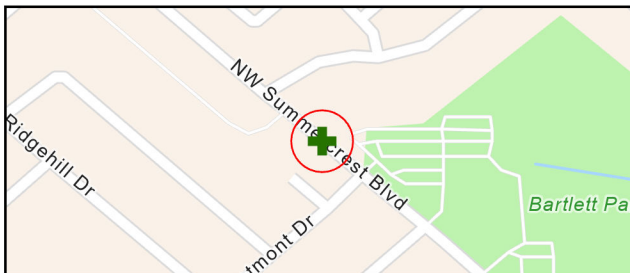

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head	X	X							Install countdown pedestrian signal head
Missing head symbol	X	X							Install countdown pedestrian signal head
Head does not show countdown	X	X							Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"	X								Relocate pedestrian push buttons
Push button is missing band		X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length		X							Remove and replace clear floor space
Running slope at push button is greater than 2.1%		X							Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run		X							Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	1	1							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


S Midblock of NW Summercrest Blvd

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	2	\$ 6,400
2	0	\$ 0
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 6,400

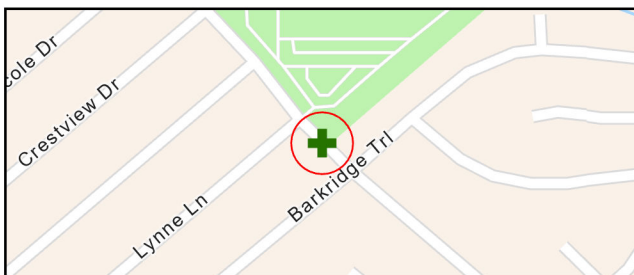

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head	X	X							Install countdown pedestrian signal head
Missing head symbol	X	X							Install countdown pedestrian signal head
Head does not show countdown	X	X							Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%	X	X							Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run									
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	1	1							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


Midblock of Elk Dr

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	2	\$ 6,400
2	0	\$ 0
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 6,400

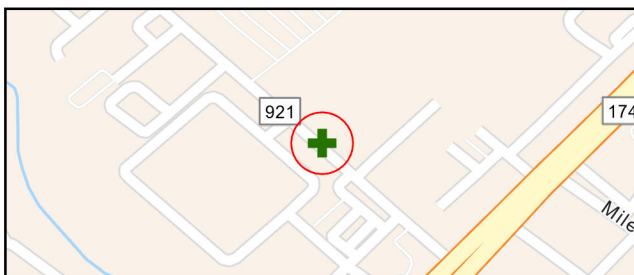

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head	X	X							Install countdown pedestrian signal head
Missing head symbol									
Head does not show countdown	X	X							Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%		X							Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run									
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	1	1							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


W Hidden Creek Pkwy & Irene St

Signal Map

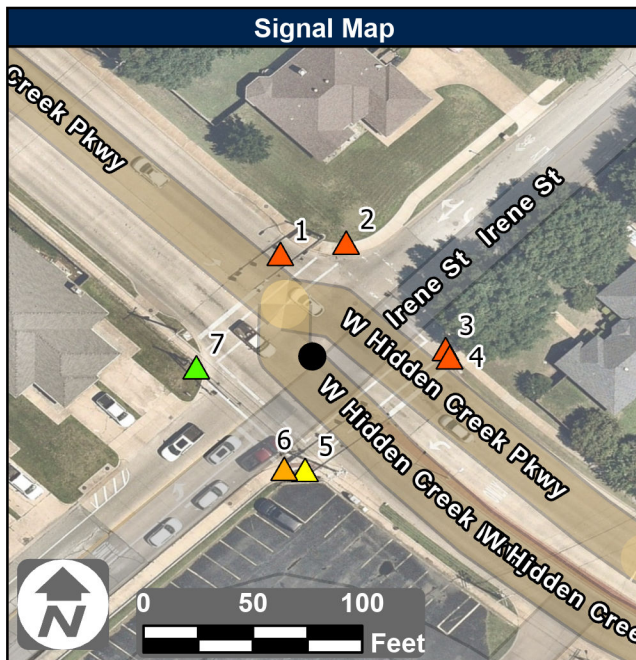

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	4	\$ 1,040
3	1	\$ 1,800
4	1	\$ 4,500
5	1	\$ 0
Total	7	\$ 7,340

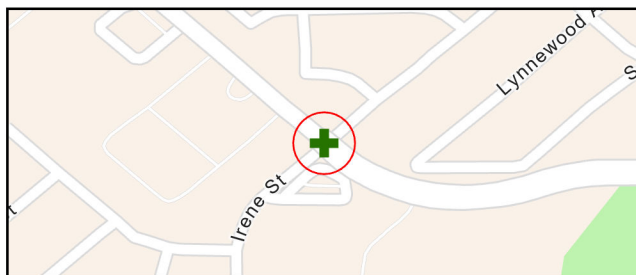

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button									
Distance to adjacent button is greater than 10 ft					X				Relocate pedestrian push buttons
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X		Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing					X				Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length			X						Remove and replace clear floor space
Running slope at push button is greater than 2.1%				X	X	X			Remove and replace clear floor space
Cross slope at push button is greater than 2.1%	X			X					Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X		X	X	X		Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk						X			Relocate pedestrian push buttons
Push button does not service ramp									
Signal Priority	2	2	2	2	4	3	5		

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


W Hidden Creek Pkwy & SE Gardens Blvd

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	0	\$ 0
2 ▲	3	\$ 780
3 ▲	3	\$ 5,400
4 ▲	2	\$ 9,000
5 ▲	0	\$ 0
Total	8	\$ 15,180

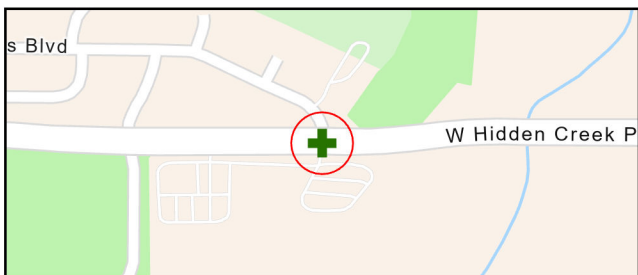

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button	X								Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%					X				Remove and replace clear floor space
Cross slope at push button is greater than 2.1%		X							Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X	X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	4	2	4	2	3	2	3	3	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


W Hidden Creek Pkwy & Hidden Vistas Blvd

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	1	\$ 260
3	1	\$ 1,800
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 2,060

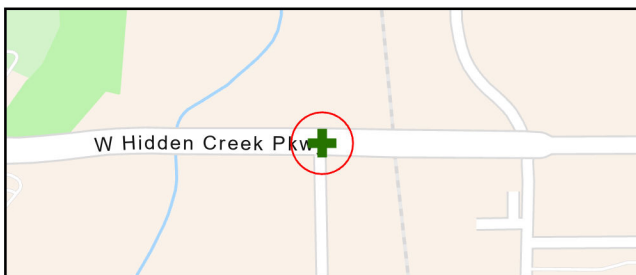

Signal Observations

Issue	Map Feature Number								Possible Solution
	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%									
Cross slope at push button is greater than 2.1%	X								Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X							Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	2	3							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


W Hidden Creek Pkwy & S Dobson St

Signal Map

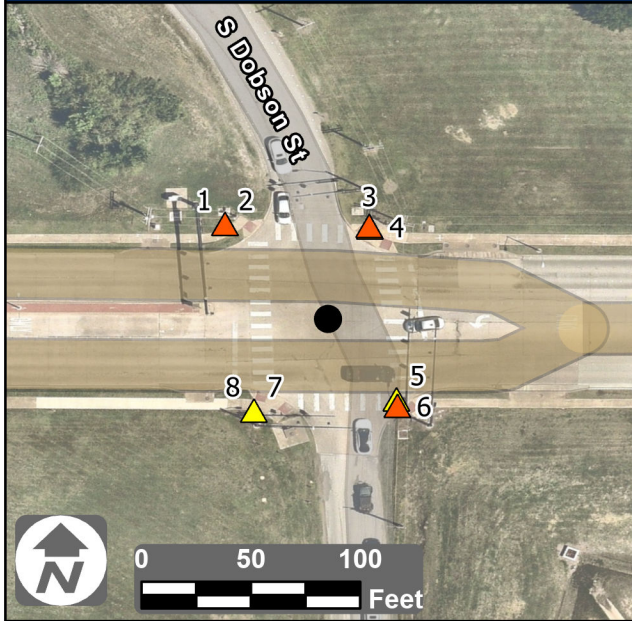

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	4	\$ 2,580
3	1	\$ 1,800
4	3	\$ 9,600
5	0	\$ 0
Total	8	\$ 13,980

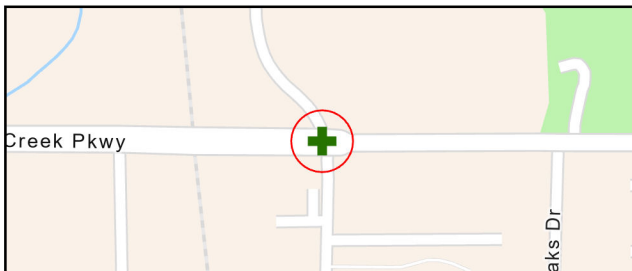

Signal Observations

Issue	Map Feature Number								Possible Solution
	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown	X	X	X	X	X	X	X	X	Install countdown pedestrian signal head
Missing push button									
Missing adjacent button					X				Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%				X					Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X	X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk	X	X	X						Relocate pedestrian push buttons
Push button does not service ramp									
Signal Priority	2	2	2	3	4	2	4	4	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location

E Hidden Creek Pkwy West

Signal Map

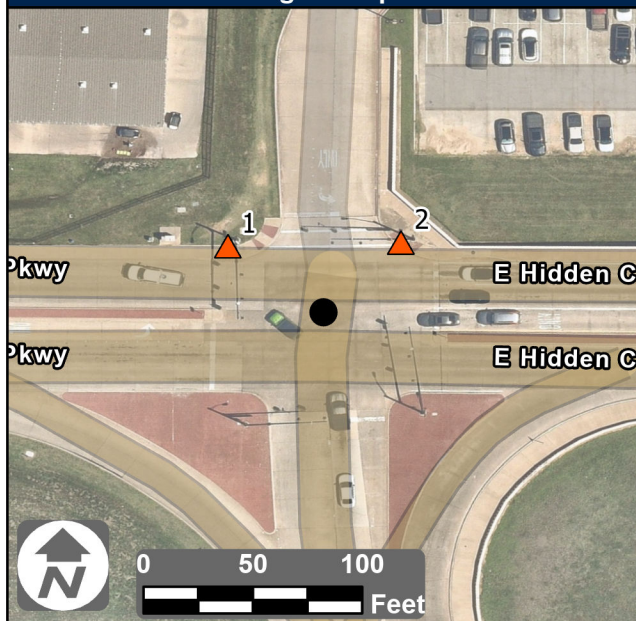

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	2	\$ 520
3	0	\$ 0
4	0	\$ 0
5	0	\$ 0
Total	2	\$ 520



Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown	X	X							Install countdown pedestrian signal head
Missing push button									
Missing adjacent button	X	X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message	X	X							Remove PBs and replace with APS push buttons
Push button height is greater than 48"									
Push button is missing band	X	X							Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone	X	X							Remove PBs and replace with APS push buttons
Push button is missing percussive tone	X	X							Remove PBs and replace with APS push buttons
Push button is not vibrotactile	X	X							Remove PBs and replace with APS push buttons
Push button does not vibrate on walk	X	X							Remove PBs and replace with APS push buttons
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X	X							Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%		X							Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X								Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	2	2							

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


E Hidden Creek Pkwy East

Signal Map

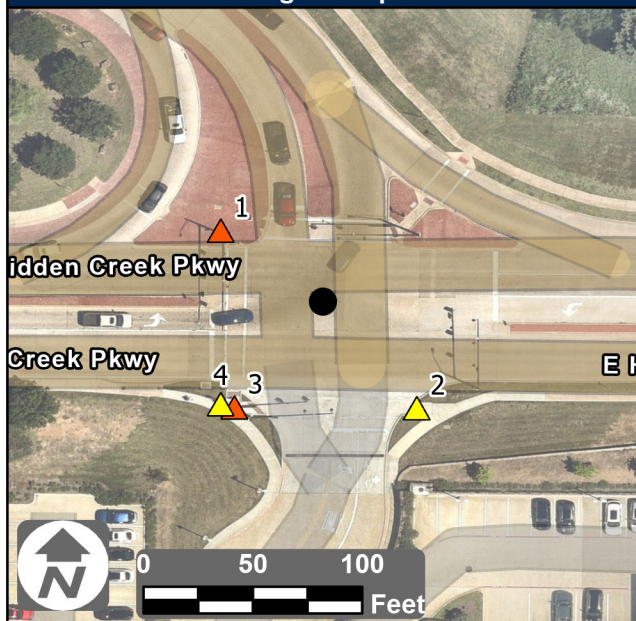

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	0	\$ 0
2 ▲	2	\$ 520
3 ▲	0	\$ 0
4 ▲	2	\$ 7,700
5 ▲	0	\$ 0
Total	4	\$ 8,220

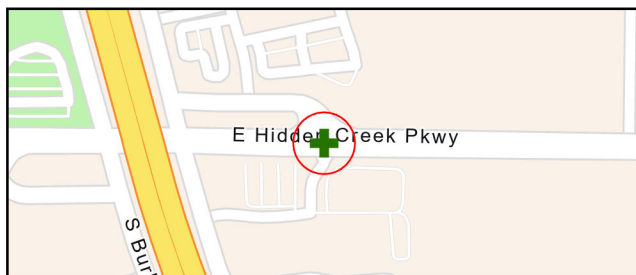

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown	X			X					Install countdown pedestrian signal head
Missing push button									
Missing adjacent button		X							Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft	X		X	X					Relocate pedestrian push buttons
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X					Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%									
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run		X	X	X					Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	2	4	2	4					

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.


Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


E Hidden Creek Pkwy & S Hurst Rd

Signal Map

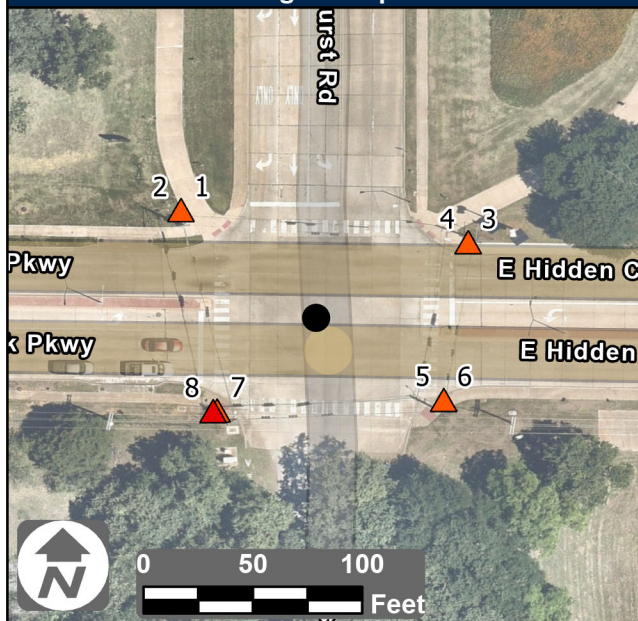

Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	3	\$ 17,200
2 ▲	5	\$ 1,300
3 ▲	0	\$ 0
4 ▲	0	\$ 0
5 ▲	0	\$ 0
Total	8	\$ 18,500

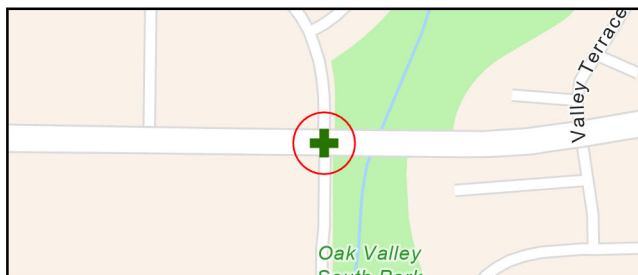

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head			X						Install countdown pedestrian signal head
Missing head symbol	X	X	X					X	Install countdown pedestrian signal head
Head does not show countdown									
Missing push button	X							X	Install pedestrian push button
Missing adjacent button									
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing	X								Remove PBs and replace with APS push buttons
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%	X	X			X	X	X		Remove and replace clear floor space
Cross slope at push button is greater than 2.1%					X	X			Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X	X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk		X		X	X				Relocate pedestrian push buttons
Push button does not service ramp									
Signal Priority	1	2	1	2	2	2	2	1	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


E Hidden Creek Pkwy & Cardinal Ridge Rd

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1 ▲	0	\$ 0
2 ▲	1	\$ 260
3 ▲	2	\$ 3,600
4 ▲	1	\$ 4,500
5 ▲	4	\$ 0
Total	8	\$ 8,360

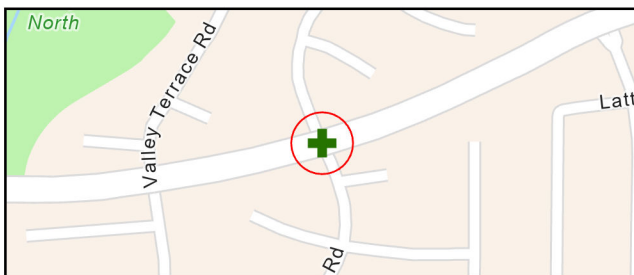

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button	X	X			X		X	X	Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X	X	X	X	X	Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%				X		X	X		Remove and replace clear floor space
Cross slope at push button is greater than 2.1%	X								Remove and replace clear floor space
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X	X	X	X	X	Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	2	5	3	3	5	4	5	5	

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.

Location


E Hidden Creek Pkwy & Arrowroad Dr

Signal Map



Conceptual Budget Estimate

Barrier Priority	Quantity	Cost
1	0	\$ 0
2	0	\$ 0
3	4	\$ 7,200
4	0	\$ 0
5	0	\$ 0
Total	4	\$ 7,200

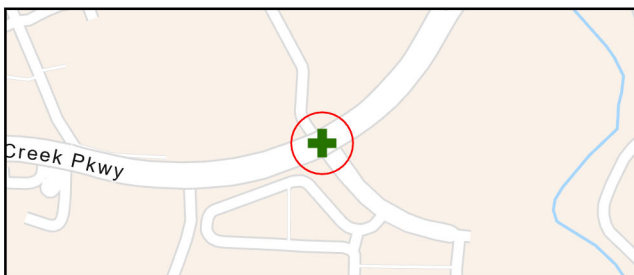

Signal Observations

Issue

Map Feature Number

Possible Solution

	1	2	3	4	5	6	7	8	
Missing signal head									
Missing head symbol									
Head does not show countdown									
Missing push button									
Missing adjacent button	X	X		X					Install adjacent pedestrian push button
Distance to adjacent button is greater than 10 ft									
Missing speech message									
Push button height is greater than 48"									
Push button is missing band	X	X	X	X					Remove PBs and replace with APS push buttons
Push button is not fingerless									
Push button is missing locator tone									
Push button is missing percussive tone									
Push button is not vibrotactile									
Push button does not vibrate on walk									
Push button is not parallel to the associated crosswalk									
Push button arrow contrasting missing									
Push button does not have sufficient clear floor width									
Push button does not have sufficient clear floor length									
Running slope at push button is greater than 2.1%				X					Remove and replace clear floor space
Cross slope at push button is greater than 2.1%									
Floor at push button is not firm or stable									
Push button is offset more than 5' from curb ramp run	X	X	X	X					Relocate pedestrian push buttons
Push button is offset more than 5' from edge of crosswalk									
Push button does not service ramp									
Signal Priority	3	3	3	3					

Conceptual Budget Estimate Disclaimer

This "cost report" assigns a conceptual budget estimate to resolve non-compliance issues and was developed for planning purposes only. Kimley-Horn has no control over the cost of labor, materials, equipment, or over the Contractor's methods of determining prices or over competitive bidding or market conditions. Opinions of probable costs provided herein are based on the information known to Kimley-Horn at this time and represent only Kimley-Horn's judgment as a design professional familiar with the construction industry. Kimley-Horn cannot and does not guarantee that proposals, bids, or actual construction costs will not vary from its opinions of probable costs.

Other Intersection Information

Conceptual budget information for curb ramp, crosswalk, and sidewalk improvements are included in the sidewalk corridor reports.