



June 6, 2025

Mr. Rich Hussey
LAI, LTD
Dahme Mechanical
610 Arthur Ave
Arlington Heights, IL 60005

RE: Wemco CF3 10x8 City of Crest Hill Arthur Ave Water Pump
Serial Number: 85345-1-1
Customer Reference Order #: N/A
Kennedy Industries #: 128884

Mr. Hussey:

Attached are photos with descriptions of the parts in need of repair or replacement. If you have any questions, please do not hesitate to contact us.

Sincerely,

Mike Horn


Repair Center Manager
KENNEDY INDUSTRIES, INC.



KENNEDY
INDUSTRIES

INNOVATE
SOLVE
MONITOR
REPAIR

PUMP

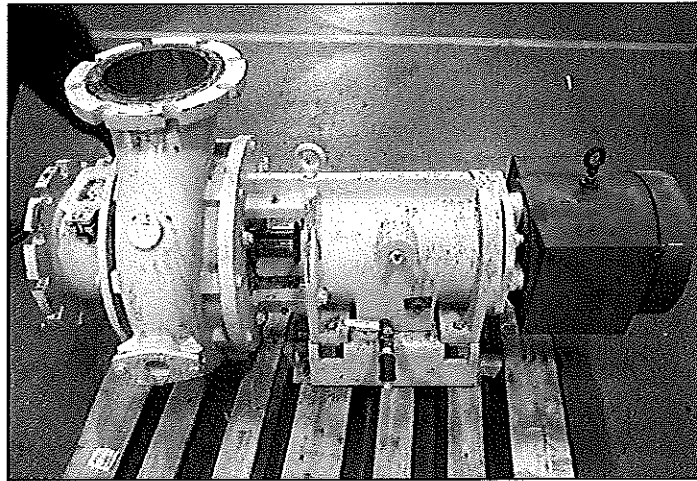

- Pump upon arrival.
- Pump does not turn freely by hand.

IMPELLER



- Impeller is in good condition.
- Impeller will be reused.



KENNEDY
INDUSTRIES

INNOVATE
SOLVE
MONITOR
REPAIR

BEARINGS



- Bearings show normal wear.
- Bearings will be replaced with new.

MECHANICAL SEAL




- Mechanical Seal is heavily worn.
- Mechanical Seal will be replaced with new OEM Mechanical Seal.



KENNEDY
INDUSTRIES

INNOVATE
SOLVE
MONITOR
REPAIR

BEARING COVER

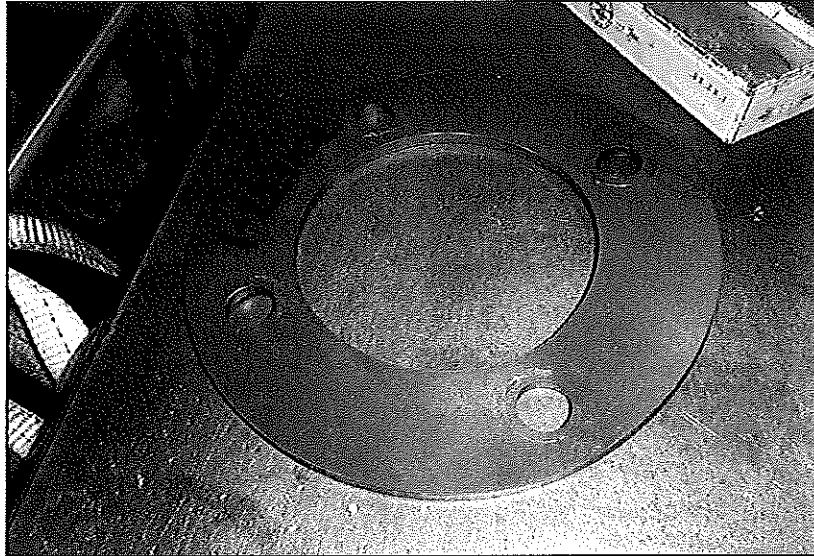

- Bearing cover is bent and beyond repair.
- Bearing cover will be replaced with new.