
Roof Service Work Proposal For: Public Library – Slate to Brick Flashing Repair Scope of Work: Set up Safety Zone in front of work area, this may impact the ADA access ramp and close it for short periods. • Remove and preserve (some may break on removal and will be replaced as needed) slate shingles · Remove existing brick surface mounted lead coated copper counter flashing Furnish and Install Grace Ultra High Temp Ice/Watershield as a waterproof Selfsealing underlayment for the shingles and brick counter flashing. Furnish and install New Lead Coated Copper Step Flashing in too the brick and under slate Replace original Slate and replace any slate damaged during the removal process. Remove all safety zone set up Date:



Top Roofers

18 No. Main St. Newmarket, NH 03857 US 603-292-5906 donna@toproofersllc.com http://www.toproofersllc.com

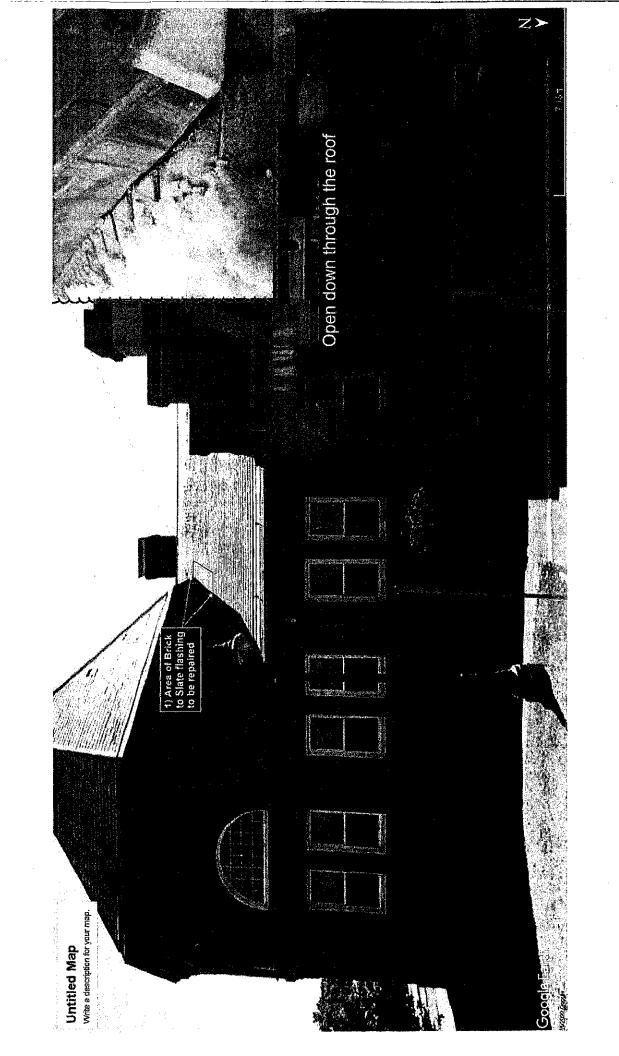

ADDRESS

Newmarket Town Library 1 Elm St Newmarket, NH 03857 USA Estimate 1583

DATE 03/22/2022

ACTIVITY			QTY		RATE	AMOUNT
Commercial slate 1 Elm St, Newmarket, NH	•					
Mobilization.		F P C C C C C C C C C C C C C C C C C C	ggaggeruder skipnings akkelennaggaskerskeinskabbyggers praksigen kappyniser	naang juggangaan goggap saansiin saa segasi sea saan sanasa senassa	4	nternet frances statement of the format in fina material ways grape many to the state of the state of the state
	es going up along brick wall eeds to be replaced.		proppelstroussentistings of many course many against	upupppanussyn needd u parken versseg actedemic	saadillis facklaaligy farmoon h. tamou fackana tart falgatabi biski saka	describbled if source about the first washed road from coron and related if the solid Helico.
Grind out mortar	around existing lead flashing.		***************************************	***************************************		
Install ice and wa to brick wall.	ater shield from roof decking up	s ann nagagh eil mong y ausgassi innes y yangas sarethna moyo s satemna.	uanulmit forwarus well blook amelik i til disconskibil simulik ka muslisk	t verensinan ski obenský histolikalevská liki bekessási či běklení.	neterlikkensk (udelande beddische derek ein delber ut av Makk beet beddisch schale	SOUNGELINGENING STATE OF THE ST
	flashing with proper overlap to er drainage from underneath					
Install new slate	tiles over flashing.	thinks statish. Man n. Willed a selam at the transport William				
Install new slat repairs	te tiles if any were broken during					
Labor, materials,	, clean-up.					
Sales Total cost of repa	airs:		··			7,450.00

TOTAL

\$7,450.00

Accepted By

Accepted Date



Date: 2/17/2022

From: Ethan Owens - Service Manager Tecta America - Portland, ME

Attn: David Riley - Director of Facilities

Roof Service Work Proposal For:

Public Library - Slate to Brick Flashing Repair

Scope of Work:

Tecta America New England Service Department will: Please see attached site plan

- Set up Safety Zone in front of work area, this may impact the ADA access ramp and close it for short periods.
- Remove and preserve (some may break on removal and will be replaced as needed) slate shingles
- Remove existing brick surface mounted lead coated copper counter flashing
- Furnish and Install Grace Ultra High Temp Ice/Watershield as a waterproof Selfsealing underlayment for the shingles and brick counter flashing.
- Furnish and install New Lead Coated Copper Step Flashing in too the brick and under slate
- Replace original Slate and replace any slate damaged during the removal process.
- Remove all safety zone set up

TOTAL LABOR & MATERIALS:	\$9,575.00
Customer Approval:	Date: